
Simulated measurement



Non-contact infrared thermometer featuring simple, one-touch measurement



Easily measure temperature in hazardous or unreachable locations

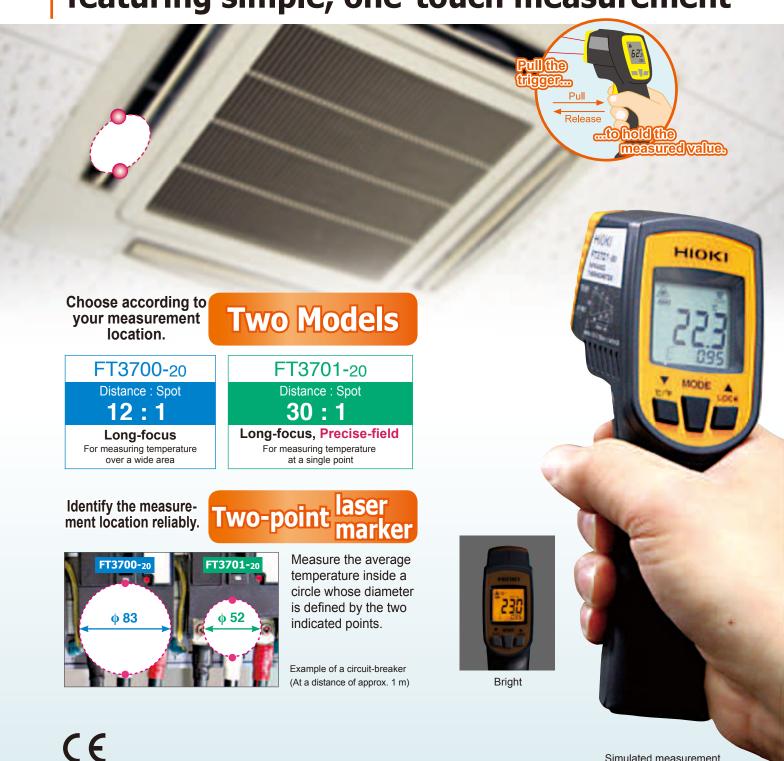






Useful **Functions**


- MAX, MIN, DIF (MAX-MIN), AVG measurement
- Alarm function
 Emissivity (ε) can be set based on the measurement target
- Continuous measurement Backlight

Specifications (Accuracy guaranteed for 1 year)

•	, , , , , , , , , , , , , , , , , , , ,	
	FT3700- ₂₀	FT3701-20
Measurement temperature range		-60.0 to 760.0 °C (-76 to 1400 °F) Guaranteed accuracy range is -35 to 500°C. (-31.0 to 932.0 °F)
Accuracy	0.0 to 100.0 °C (-32.0 to 212.0 °F): ±2 °C 100.1 to 500.0 °C (212.1 to 932.0 °F): ±2%rdg35.0 to -0.1 °C (-31.0 to 31.9 °F): ±10%rdg.±2 °C -60.0 to -35.1 °C (-76.0 to -31.1 °F): Accuracy not specified 500.1 to 550.0 °C (932.0 to 1022 °F) (FT3700-20) 500.1 to 760.0 °C (932.0 to 1400 °F) (FT3701-20): Accuracy not specified	
Accuracy guarantee for temperature and humidity	23 °C ±3 °C (73 °F ±5 °F) 80% RH or less (non-condensating)	
Temperature coefficient	Measurement accurary × 0.1/ °C	
Diameter of field of measurement	83 mm at 1000 mm (Distance : Spot = 12 : 1)	100 mm at 3000 mm (Distance : Spot = 30 : 1)
Response time	1 second (90%)	
Detection element	Thermopile	
Sighting	Two-point laser marker max 1mW (class 2), Red	
Measurement wavelength	$$8\ \text{to}\ 14\ \mu\text{m}$$ [Thermal emissivity compensation]0.10 to 1.00 by steps of 0.01	
Functions	MAX/ MIN/ DIF (MAX-MIN)/ AVG measurement, Alarm function, Backlight function	
Operating temperature and humidity	0 to 50°C (32°F to 122°F), 80%RH or less (non-condensating)	
Storage temperature and humidity	-10 to 50° C (14° F to 122° F), 80° RH or less (non-condensating) 50 to 60° C (122° F to 140° F), 70° RH or less (non-condensating)	
Applicable standards	EMC : EN61326 Laser : IEC60825-1 CLASS 2 LASER	
Power supply	LR03 alkaline battery \times 2, 150mVA [Continuous operating time: Approx. 140 hours] (When laser marker and backlight are OFF)	
Dimensions	Approx.48 W \times 172 H \times 119 D mm (1.89" W \times 6.77" H \times 4.69" D) (excluding projections)	
Mass	Approx. 256 g (9.0 oz.) (including LR03 alkaline battery × 2)	
Accessories	$\label{eq:local_local_local} Instruction \ manual \times 1, LR03 \ alkaline \ battery \times 2 \ (supplied \ with this product for initial use only), Carrying \ case \times 1$	

Measurement focus D: Distance (mm) S: Spot (mm)





Model: INFRARED THERMOMETER

Model No. (Order Code) (Note) FT3700-20 (Long-focus type) (Long focus, precise-field type) FT3701-20 Accessories: Instruction manual ×1, LR03 alkaline battery ×2, Carrying case ×1





Laser Product Caution Notice

A caution label is attached to the thermometer. Be sure to observe the operating precautions on

Contact infrared thermometer

Supports temperature management needs of various applications

- Compact and weighing only 160g
- More than 200 hours of continuous operation on a single battery
- An assortment of 9 optional temperature sensors





TEMPERATURE HITESTER 3441 (Economically priced)

TEMPERATURE HITESTER 3442 (Waterproof design)



堉宸科技股份有限公司 02-2995-2696 www.yuctech.com.tw LINE ID: @678pknts

